

# Manhole Inspection Summary

Manhole # S45KK\_023MH

Printed On: 6/24/2010

Page 1 of 4

**Inspection** ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **45KK** Node: **023** Status: **Found**

Insp Date: **3/16/10 5:36 PM**

Incomplete Comments

**Broken pipe is present in the sewer line which is causing this manhole to consistently surcharge. Field crews were able to relieve surcharge in order to obtain photos of the MH. However, the broken pipe needs to be repaired in order to eliminate the problem.**

Crew: **jl, ct**  
Inspector: **Provine, D**  
Firm: **JV**

**Location** Address: **Lanvale**

Cross Street: **Wolfe**

**Manhole** Type: **Terminal**

Location: **Alley**

Ground Conditions: **Wet**

☐ Prev. Rehab

Weather: **Light Rain**

Subject To Ponding: **None**

Comments **Pass**

**Cover**

Shape: **Circular**

Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame**

Offset: **0** (in.)

Condition: ☐ Sound

☐ Cracked

☒ **Leaks**

**Chimney / Frame Adjustment**

☒ Exists Material: **Brick**

☐ Parged Height: **8** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Corbel**

Material: **Brick**

☐ Parged

Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel**

Material: **Brick**

☐ Parged

Shape: **Circular**

Diameter: **48** (in.) Length: (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Bench**

☐ Exists Material:

☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel**

Material: **Brick**

☐ Parged

Channel Exposure: **Fully Open**

Junc Dist: **0**

nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Steps**

Count: **4** Missing: **0** ☐ Corroded

**Surcharge**

☒ **Evidence Of Surcharge**

Depth: **5** (ft.)

☐ Active Surcharge Present

Location View



Location View



Location View



Location View



Top View



Top View



Top View



Manhole Inspection Summary

Manhole # S45KK\_023MH


Printed On: 6/24/2010

Page 4 of 4

8 in. Circular Gravity Sewer  
Pipe Out @ 12 O'Clock



Pipe Out @ 12 O'Clock

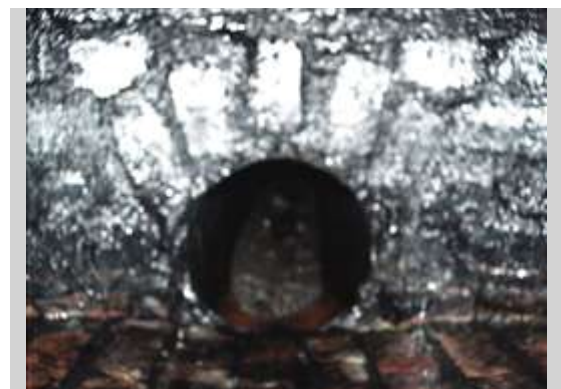

12 O'Clock Outflow  
Pipe Out @ 12 O'Clock



Pipe Height: **8.4** (in.) Rod and Bar (Angled)  
Pipe Material: **Clay** ☐ Pipe Lined  
Invert Depth: **9.17** (ft.) Flow Characteristics: **Slow**  
Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease  
Silt Depth: (in.) Deposits Extent:  
Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Connecting Node Not Available**

☐ Possible Illicit Connection